

ABERDEEN LIFTING SERVICES LTD

CERTIFICATE OF TEST, EXAMINATION, AND INSPECTION REPORT

Provision and use of Work Equipment Regulations-SI 2306

Lifting Operations and Lifting Equipment Regulations- SI 2307



CLIENT:	BLUE MANTA 6 KIRKTON AVENUE PITMEDDEN RD IND EST DYCE ABERDEEN AB21 0BF	TEST HOUSE:	ABERDEEN LIFTING SERVICES LTD HOWE MOSS CRESCENT KIRKHILL INDUSTRIAL ESTATE, DYCE ABERDEEN AB21 0GN TEL: 01224 723333 FAX: 01224 723311
P.O. NO:	41267	REQUISITION NO:	
CERT NO:	ALS225-05	INSPECTION DATE:	09/12/2022

SERIAL NO:	QTY	DESCRIPTION	SWL/PAYLOAD	PROOF LOAD
BM-PBF-050	1	TEST CLAMP BOX FRAME TO DNVGL-ST-E271 & ISO-10855& LRQA CCS 1.40M x 1.20M x 1.56M APPROX ALL WELDED STEEL CONSTRUCTION C/W 4 TOP CORNER MOUNTED LIFTING POINTS TARE WT: 600 KGS GROSS WT: 2100 KGS 4 POINT TEST	1500 KGS	5250 KGS

M.P.I INSPECTION DETAILS


PROCEDURE:	WI ALNDT.01A REV05	EQUIPMENT:	Y6 YOKE (NW8728)	METHOD:	WET CONTINUOUS
SPECIFICATION:	ASTM E1444/E1444M-16e1 & BS EN ISO 23278:2015 & BS EN ISO 17638:2016	MEDIA:	NPT 16 WHITE PAINT	INSPECTOR:	D. BUCHAN
MATERIAL:	WELDED CARBON STEEL	INDICATOR:	BLACK INK	QUALS:	PCN II

RESULTS: A MAGNETIC PARTICLE INSPECTION WAS CARRIED OUT ON LIFTING POINT WELDMENTS. ON THE EQUIPMENT NO CRACK OR CRACKLIKE INDICATIONS WERE NOTED AT TIME OF INSPECTION.

DECLARATION: I HEREBY DECLARE THAT THE ABOVE INFORMATION IS CORRECT AND THE EQUIPMENT HAS BEEN TESTED AND THOROUGHLY EXAMINED IN ACCORDANCE WITH THE APPROPRIATE PROVISIONS AND IS FREE FROM DEFECTS AFFECTING SAFETY.

	COMPLETED BY
ENGINEER	D. BUCHAN
SIGNATURE	
DATE	09/12/2022

NEXT INSPECTION DATE: 08/06/2023
DATE OF MANUFACTURE: 12/2022

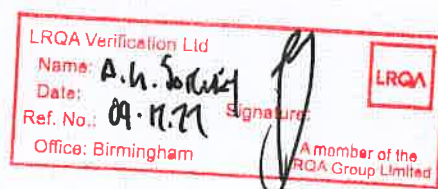

ABERDEEN LIFTING SERVICES LTD

MAGNETIC PARTICLE INSPECTION REPORT



CUSTOMER: BLUE MANTA	LOCATION: ALS YARD
P.O. No: 41267	CERT No: ALS225-06
JOB No:	DATE OF INSP: 09/12/2022

JOB DESCRIPTION:

100% MAGNETIC PARTICLE INSPECTION CARRIED OUT PRE & POST LOAD TEST ON ALL MAIN LOAD BEARING WELDS AND 20% SECONDARY WELD

ITEM: TEST CLAMP BOX FRAME	
QUANTITY: 1	SURFACE: AS WELDED
SERIAL No: BM-PBF-050	EQUIPMENT: Y6 YOKE (NW8728)
DRG. No: N/A	MEDIA: NPT 16 WHITE PAINT
MATERIAL: CARBON STEEL	INDICATOR: BLACK INK
PROCEDURE: WJ ALNDT.01A REV 05	METHOD: WET CONTINUOUS
SPECIFICATION: ASTM E1444/E144M-16e1, BSEN ISO 23278:2015, BSEN ISO 17638:2016	QUALIFICATIONS: PCN II

RESULTS: NO CRACK OR CRACKLIKE INDICATIONS ARE NOTED AT TIME OF INSPECTION.

	COMPLETED BY
ENGINEER/TECHNICIAN	D. BUCHAN
SIGNATURE	
DATE	09/12/2022