

ABERDEEN LIFTING SERVICES LTD

CERTIFICATE OF TEST, EXAMINATION AND INSPECTION REPORT

Provision and use of Work Equipment Regulations-SI 2306

Lifting Operations and Lifting Equipment Regulations- SI 2307



CLIENT:	BLUE MANTA 6 KIRKTON AVENUE PITMEDDEN RD IND EST DYCE ABERDEEN AB21 0BF	TEST HOUSE:	ABERDEEN LIFTING SERVICES LTD HOWE MOSS CRESCENT KIRKHILL INDUSTRIAL ESTATE, DYCE ABERDEEN AB21 0GN TEL: 01224 723333 FAX: 01224 723311
P.O. NO:	27744	REQUISITION NO:	
CERT NO:	J7563-06	INSPECTION DATE:	29/01/2018

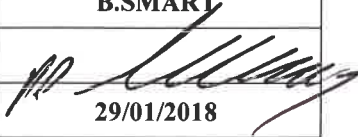
SERIAL NO:	QTY	DESCRIPTION	SWL/PAYLOAD	PROOF LOAD
BM-DSW-0812	1	DUEL LINE SHEAVE TO DNV2.22 FITTED WITH 1 TOP LIFT POINT	2000 KGS LINE PULL 8000 KGS HEAD FITTING	16000 KGS HEAD FITTING
812/A	1	SAFETY PIN BOW SHACKLE (POLAR)	8.5 TON	17 TON
12B-12C	2	SAFETY PIN BOW SHACKLES (POLAR)	2 TON	4 TON

M.P.I INSPECTION DETAILS

PROCEDURE:	ALNDT.01A REV 03	EQUIPMENT:	Y6 YOKE (NW8744)	METHOD:	WET CONTINUOUS
SPECIFICATION:	ASTME1444/E144 4M-16e1	MEDIA:	NPT 16 WHITE PAINT	INSPECTOR:	B.SMART
MATERIAL:	WELDED CARBON STEEL	INDICATOR:	BLACK INK	QUALS:	SNT II

RESULTS: A MAGNETIC PARTICLE INSPECTION WAS CARRIED OUT ON LIFTING POINT WELDMENTS. ON THE EQUIPMENT NO CRACK OR CRACKLIKE INDICATIONS WERE NOTED AT TIME OF INSPECTION.

DECLARATION: I HEREBY DECLARE THAT THE ABOVE INFORMATION IS CORRECT AND THE EQUIPMENT HAS BEEN TESTED AND THOROUGHLY EXAMINED IN ACCORDANCE WITH THE APPROPRIATE PROVISIONS AND IS FREE FROM DEFECTS AFFECTING SAFETY.

	COMPLETED BY
ENGINEER	B.SMART
SIGNATURE	
DATE	29/01/2018

NEXT INSPECTION DATE: 28/07/2018
DATE OF MANUFACTURE: 01/2018

ABERDEEN LIFTING SERVICES LTD



MAGNETIC PARTICLE INSPECTION REPORT

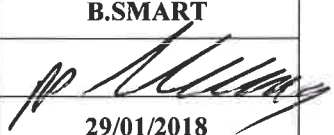
CUSTOMER: BLUE MANTA	LOCATION: ALS YARD
P.O. No: 27744	CERT No: J7563-12
JOB No:	DATE OF INSP: 29/01/2018

JOB DESCRIPTION:

100% MAGNETIC PARTICLE INSPECTION CARRIED OUT PRE & POST LOAD TEST ON ALL ACCESSIBLE WELDS

ITEM: DUEL LINE SHEAVE	
QUANTITY: 1	SURFACE: AS WELDED
SERIAL No: BM-DSW-0812	EQUIPMENT: Y6 YOKE (NW8744)
DRG. No:	MEDIA: NPT 16 WHITE PAINT
MATERIAL: CARBON STEEL	INDICATOR: BLACK INK
PROCEDURE: WI ALNDT.01A REV03	METHOD: WET CONTINUOUS
SPECIFICATION: ASTM E1444/E1444M-16e1	QUALIFICATIONS: SNT II

RESULTS: NO CRACK OR CRACKLIKE INDICATIONS ARE NOTED AT TIME OF INSPECTION.

	COMPLETED BY
ENGINEER/TECHNICIAN	B.SMART
SIGNATURE	
DATE	29/01/2018