



ABERDEEN LIFTING SERVICES LTD

CERTIFICATE OF TEST, EXAMINATION AND INSPECTION REPORT

Provision and use of Work Equipment Regulations-SI 2306

Lifting Operations and Lifting Equipment Regulations- SI 2307

CLIENT:	BLUE MANTA 6 KIRKTON AVENUE PITMEDDEN RD IND EST DYCE ABERDEEN AB21 0BF	TEST HOUSE:	ABERDEEN LIFTING SERVICES LTD UNITS 2,3&4 WOODLANDS ROAD KIRKHILL INDUSTRIAL ESTATE, DYCE ABERDEEN AB21 0GX TEL: 01224 723333 FAX: 01224 723311
P.O. NO:	13390	REQUISITION NO:	
CERT NO:	D8741-05	INSPECTION DATE:	19/03/2013

SERIAL NO:	QTY	DESCRIPTION	SWL/PAYLOAD	PROOF LOAD
BM-SW-0637	1	SHEAVE WHEEL TEST IN ACCORDANCE WITH DNV2.22 & LRS CODE LAME CH3 FITTED WITH 1 CENTRAL LIFT POINT	3 TONNE LINE PULL 6 TONNE HEAD FITTING	12 TONNE HEAD FITTING
37/1	1	SAFETY PIN BOW SHACKLE	6.5 TON	13 TON
37/2	1	SAFETY PIN BOW SHACKLE	2 TON	4 TON

M.P.I INSPECTION DETAILS

PROCEDURE:	ALNDT.01A REV 03	EQUIPMENT:	Y6 YOKE	METHOD:	WET CONTINUOUS
SPECIFICATION:	ASTME1444/E1444 M-11	MEDIA:	NPT 16 WHITE PAINT	INSPECTOR:	D.CRAIG
MATERIAL:	WELDED CARBON STEEL	INDICATOR:	BLACK INK	QUALS:	SNT 11

RESULTS: A MAGNETIC PARTICLE INSPECTION WAS CARRIED OUT ON LIFTING POINT WELDMENTS. ON THE EQUIPMENT NO CRACK OR CRACKLIKE INDICATIONS WERE NOTED AT TIME OF INSPECTION.

DECLARATION: I HEREBY DECLARE THAT THE ABOVE INFORMATION IS CORRECT AND THE EQUIPMENT HAS BEEN TESTED AND THOROUGHLY EXAMINED IN ACCORDANCE WITH THE APPROPRIATE PROVISIONS AND IS FREE FROM DEFECTS AFFECTING SAFETY.


	COMPLETED BY
ENGINEER	D.CRAIG
SIGNATURE	<i>PP 19/03/2013</i>
DATE	19/03/2013

NEXT INSPECTION DATE: 18/09/2013
DATE OF MANUFACTURE: UNKNOWN



17.04.13
WITNESSED

QF25

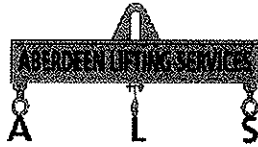

ABERDEEN LIFTING SERVICES LTD

MAGNETIC PARTICLE INSPECTION REPORT

CUSTOMER: BLUE MANTA	LOCATION: ALS YARD
P.O. No: 13390	CERT No: D8741-12
JOB No:	DATE OF INSP: 19/03/2013

JOB DESCRIPTION:

100% MAGNETIC PARTICLE INSPECTION CARRIED OUT PRE&POST LOAD TEST ON ALL ACCESSIBLE WELDS

ITEM: SHEAVE	
QUANTITY: 1	SURFACE: AS WELDED
SERIAL No: BM-SW-0637	EQUIPMENT: Y6 YOKE
DRG. No: N/A	MEDIA: NPT 16 WHITE PAINT
MATERIAL: CARBON STEEL	INDICATOR: BLACK INK
PROCEDURE: WI ALNDT.01A REV03	METHOD: WET CONTINUOUS
SPECIFICATION: ASTM E1444/E1444M-11	QUALIFICATION: ASNT LEVEL II

RESULTS: NO CRACK OR CRACKLIKE INDICATIONS ARE NOTED AT TIME OF INSPECTION.

	COMPLETED BY
ENGINEER/TECHNICIAN	D. CRAIG
SIGNATURE	<i>PP. YHec</i>
DATE	19/03/2013



CLIENT: BLUE MANTA 6 KIRKTON AVENUE PITMEDDEN RD IND EST DYCE ABERDEEN AB21 0BF	TEST HOUSE: ABERDEEN LIFTING SERVICES LTD UNITS 2,3&4 WOODLANDS ROAD KIRKHILL INDUSTRIAL ESTATE ABERDEEN AB21 0GX TEL: 01224 723333 FAX: 01224 723311
P.O. No: 13390	REQUISITION No:
CERT No: D8741-17	INSPECTION DATE: 19/03/2013

Declaration: I hereby declare that the above information is correct and the equipment has been tested and thoroughly examined in accordance with the appropriate provisions and is free from defects affecting safety.

NEXT INSPECTION DATE: 18/09/2013
DATE OF MANUFACTURE: UNKNOWN



CLIENT: BLUE MANTA 6 KIRKTON AVENUE PITMEDDEN RD IND EST DYCE ABERDEEN AB21 0BF	TEST HOUSE: ABERDEEN LIFTING SERVICES LTD UNITS 2,3&4 WOODLANDS ROAD KIRKHILL INDUSTRIAL ESTATE ABERDEEN AB21 0GX TEL: 01224 723333 FAX: 01224 723311
P.O. No: 13390	REQUISITION No:
CERT No: D8741-18	INSPECTION DATE: 19/03/2013

Declaration: I hereby declare that the above information is correct and the equipment has been tested and thoroughly examined in accordance with the appropriate provisions and is free from defects affecting safety.

NEXT INSPECTION DATE: 18/09/2013
DATE OF MANUFACTURE: UNKNOWN