



ABERDEEN LIFTING SERVICES LTD

CERTIFICATE OF TEST, EXAMINATION AND INSPECTION REPORT

Provision and use of Work Equipment Regulations-SI 2306

Lifting Operations and Lifting Equipment Regulations- SI 2307

CLIENT:	BLUE MANTA 6 KIRKTON AVENUE PITMEDDEN RD IND EST DYCE ABERDEEN AB21 0BF	TEST HOUSE:	ABERDEEN LIFTING SERVICES LTD UNITS 2,3&4 WOODLANDS ROAD KIRKHILL INDUSTRIAL ESTATE, DYCE ABERDEEN AB21 0GX TEL: 01224 723333 FAX: 01224 723311
P.O. NO:	16227	REQUISITION NO:	
CERT NO:	E7199-01	INSPECTION DATE:	20/01/2014

SERIAL NO:	QTY	DESCRIPTION	SWL/PAYLOAD	PROOF LOAD
BM-SP-7514	1	75" SPOOLING UNIT TO DNV2.7-1 & BSEN12079 2.43M x 2.30M x 2.40M APPROX ALL WELDED STEEL CONSTRUCTION C/W 4 TP MOUNTED LIFTING POINTS TARE WT: 2000 KGS GROSS WT: 11000 KGS 4 POINT TEST DIAG 2.90M GROUND TO P/E: 1.70M SHACKLES 8/5 TON	9000 KGS	27500 KGS
BM-SP-7514/1	1	4 LEG WIRE ROPE SLING TO DNV2.7-1 (2013) LEGS 2.60M x 26MM DIA IWRC FITTED TO A347/31 QUAD ASSEMBLY TENSILE GRADE: 1960N/mm ²	WLL 11 TONNE 0-45 DEG	17.4 TONNE PER LEG
14/2-5	4	SAFETY PIN BOW SHACKLES	8.5 TON	17 TON

M.P.I INSPECTION DETAILS

PROCEDURE:	ALNDT.01A REV 03	EQUIPMENT:	Y6 YOKE	METHOD:	WET CONTINUOUS
SPECIFICATION:	ASTME1444/E1444 M-11	MEDIA:	NPT 16 WHITE PAINT	INSPECTOR:	D.CRAIG
MATERIAL:	WELDED CARBON STEEL	INDICATOR:	BLACK INK	QUALS:	SNT 11

RESULTS: A MAGNETIC PARTICLE INSPECTION WAS CARRIED OUT ON LIFTING POINT WELDMENTS. ON THE EQUIPMENT NO CRACK OR CRACKLIKE INDICATIONS WERE NOTED AT TIME OF INSPECTION.


DECLARATION: I HEREBY DECLARE THAT THE ABOVE INFORMATION IS CORRECT AND THE EQUIPMENT HAS BEEN TESTED AND THOROUGHLY EXAMINED IN ACCORDANCE WITH THE APPROPRIATE PROVISIONS AND IS FREE FROM DEFECTS AFFECTING SAFETY.

	COMPLETED BY
ENGINEER	D.CRAIG
SIGNATURE	<i>PP 4/4/14</i>
DATE	20/01/2014

NEXT INSPECTION DATE: 19/07/2014
DATE OF MANUFACTURE: JANUARY 2014



QF25

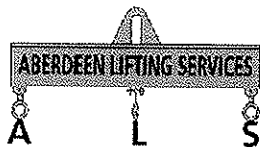

ABERDEEN LIFTING SERVICES LTD

MAGNETIC PARTICLE INSPECTION REPORT

CUSTOMER: BLUE MANTA	LOCATION: ALS YARD
P.O. No: 16227	CERT No: E7199-02
JOB No:	DATE OF INSP: 20/01/2014

JOB DESCRIPTION:

100% MAGNETIC PARTICLE INSPECTION CARRIED OUT PRE & POST LOAD TEST ON ALL LOAD BEARING WELDS AND 20% SECONDARY WELDS

ITEM: SPOOLING UNIT	
QUANTITY: 1	SURFACE: AS WELDED
SERIAL No: BM-SP-7514	EQUIPMENT: Y6 YOKE
DRG No: N/A	MEDIA: NPT 16 WHITE PAINT
MATERIAL: CARBON STEEL	INDICATOR: BLACK INK
PROCEDURE: WI ALNDT.01A REV03	METHOD: WET CONTINUOUS
SPECIFICATION: ASTM E1444/E1444M-11	QUALIFICATIONS: ASNT LEVEL II

RESULTS: NO CRACK OR CRACKLIKE INDICATIONS ARE NOTED AT TIME OF INSPECTION.

	COMPLETED BY
ENGINEER/TECHNICIAN	D.CRAIG
SIGNATURE	
DATE	20/01/2014